

OIL FIRED CABINET HEATERS FITTED WITH RL28 BURNER



WARNINGS

AmbiRad equipment must be installed and maintained in accordance with the current OFTEC Regulations for oil fired products. Due account should also be taken of any obligations arising from the Health and Safety at Works Act 1974 or relevant codes of practice. In addition the installation must be carried out in accordance with the current IEE wiring regulations (BS 7671), BS 6896 (Industrial & Commercial) and any other relevant British Standards and Codes of Practice by a qualified installer. All external wiring MUST comply with the current IEE wiring regulations.

This bulletin refers to Ambirad and Benson badged oil fired cabinet heaters fitted with Riello RL28 burners. (See photo).

Any oil fired cabinet heater fitted with a Riello RL28 burner made prior to 17/02/12 cannot be fitted with crimped type turbulators.

Later model heaters had different burners and factory fitted turbulators.

This change will only affect heaters requiring replacement heat exchangers. These are supplied with turbulators which will have to be removed for the correct operation of the heater.


Notes:

Prior to the above date turbulators were not fitted in the 205 model.


Also prior to this date the 800 & 1000 models (later called 235 & 275) were fitted with 12 smooth turbulators (see diagram).



Riello 28 oil fired burner

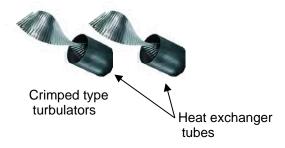

Models 800 & 1000 oil fired cabinet heaters. Turbulator positions in heat exchanger.

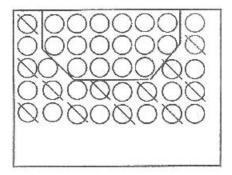

AMBIRAD LIMITED

Fens Pool Avenue Brierley Hill West Midlands DY5 1QA United Kingdom

Tel: **01384 489 700** Fax: **01384 489 707**

ambiradsales@tnb.com www.ambiradgroup.co.uk

AmbiRad Group

Heating and Ventilation Solutions







